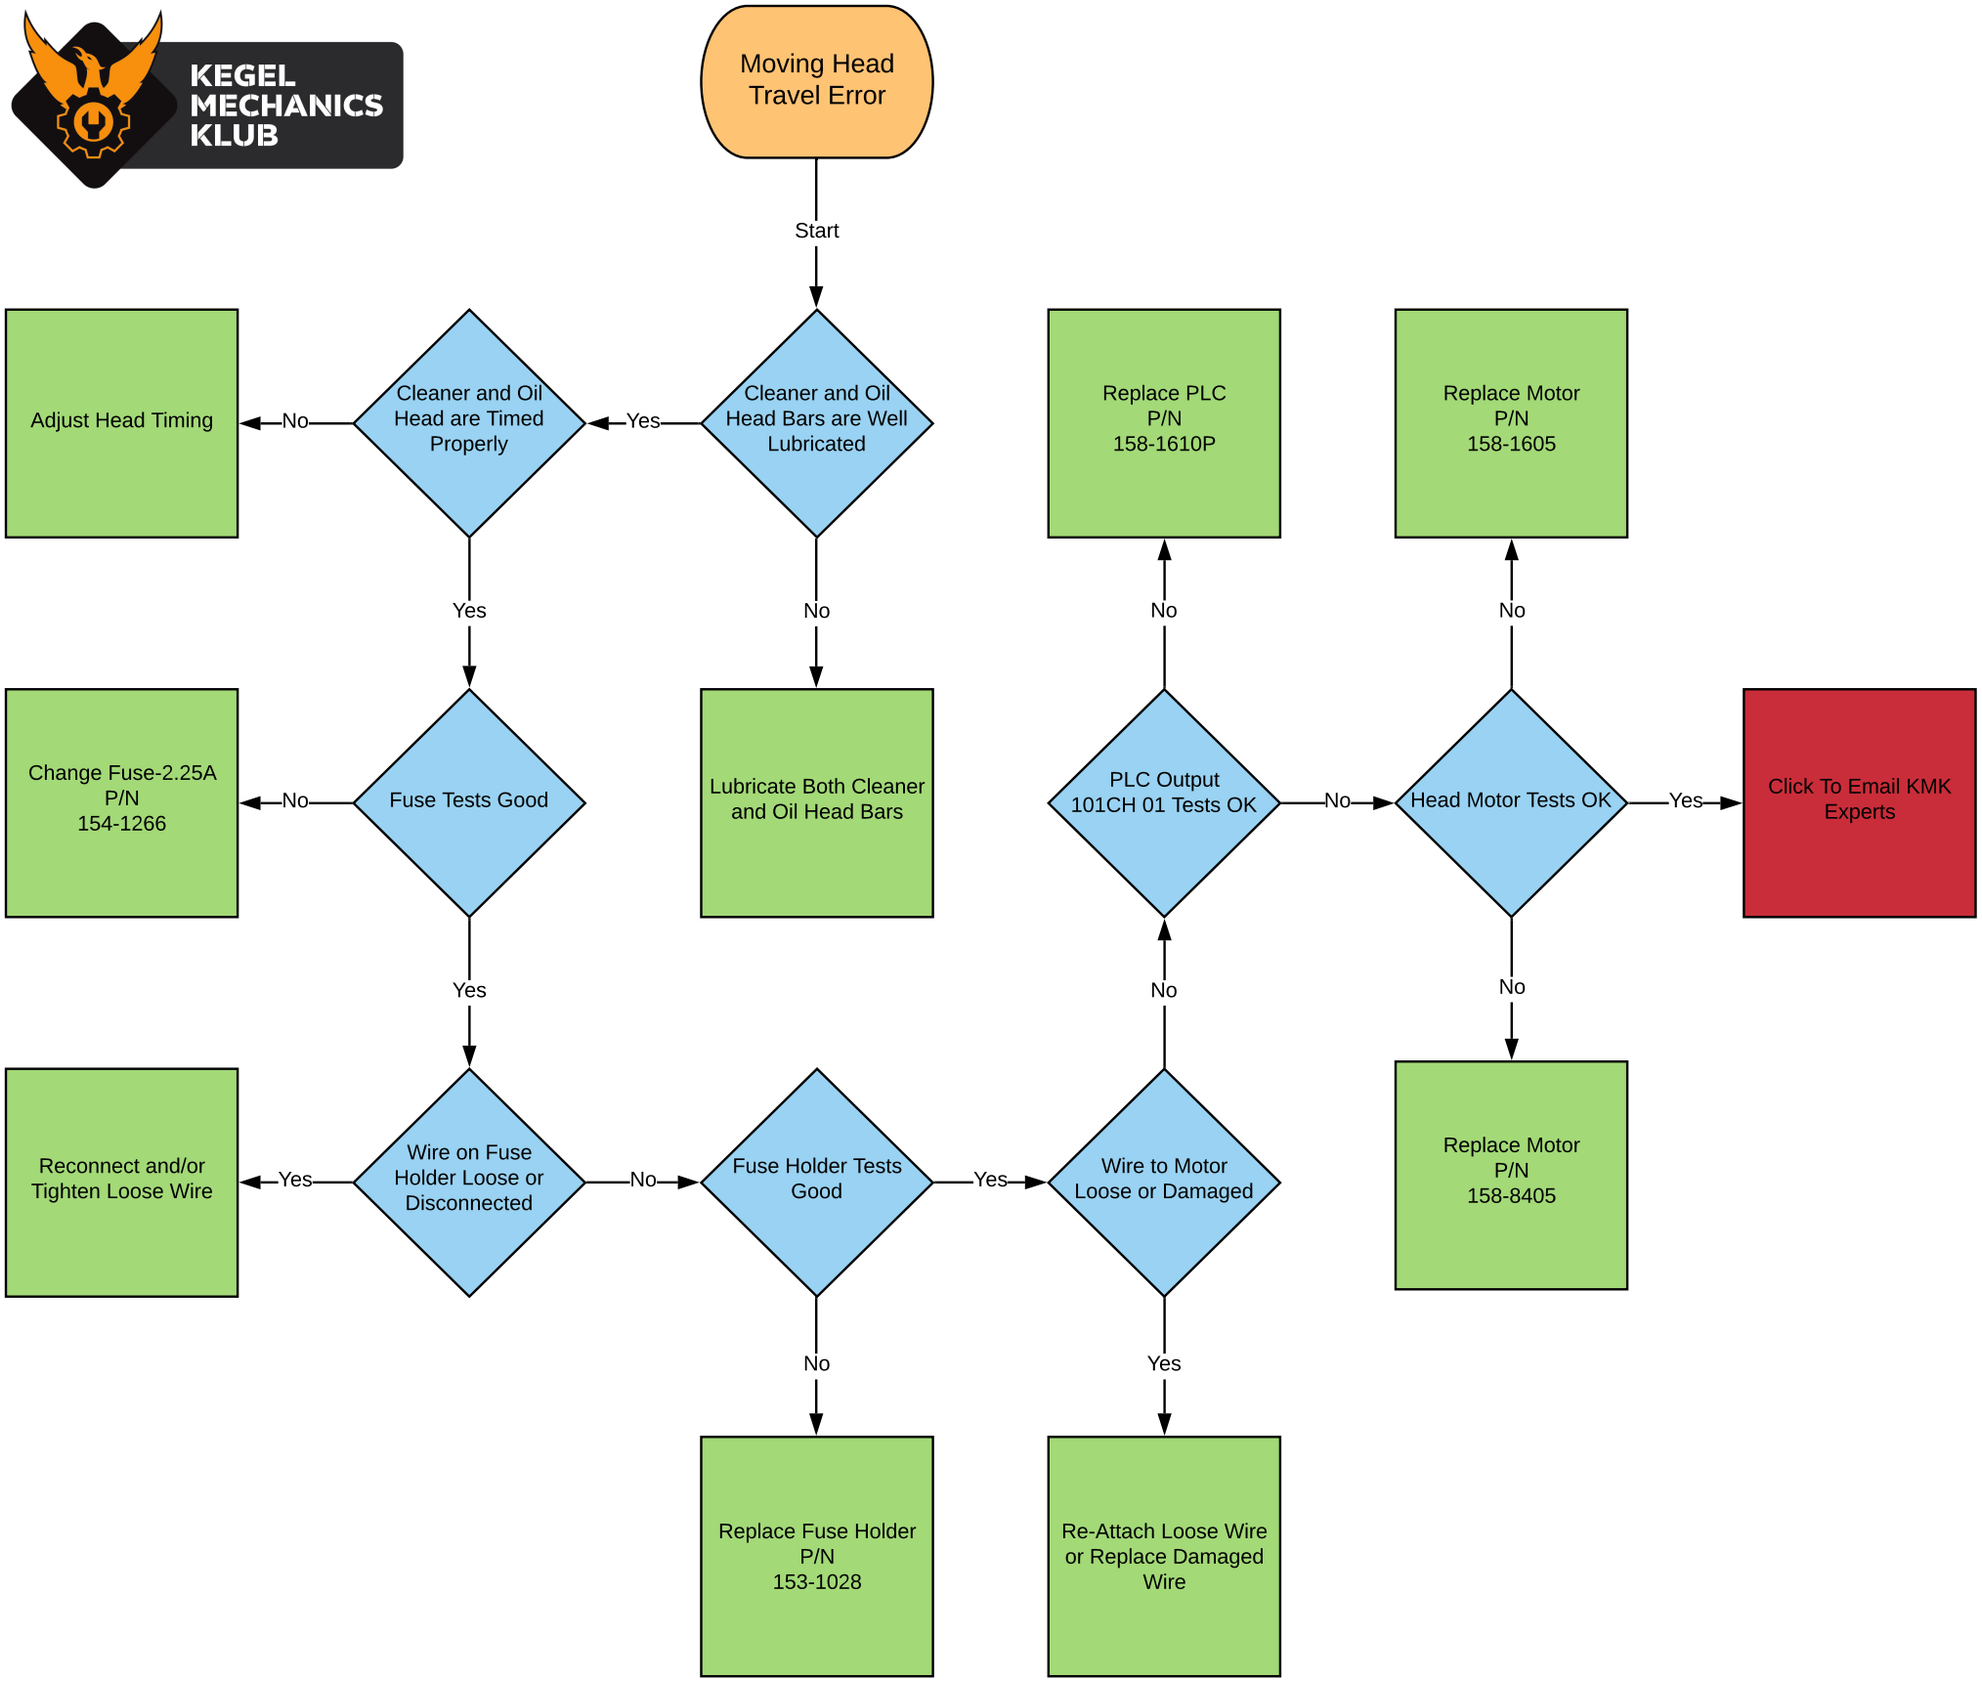
KEGEL MECHANICS KLUB
Moving Head Travel Error
Start
Cleaner and Oil Head Bars are Well Lubricated
Yes
Cleaner and Oil Head are Timed Properly
No
Adjust Head Timing
No
Lubricate Both Cleaner and Oil Head Bars
Yes
Fuse Tests Good
No
Change Fuse-2.25A P/N 154-1266
Yes
Wire on Fuse Holder Loose or Disconnected
Yes
Reconnect and/or Tighten Loose Wire
No
Fuse Holder Tests Good
No
Replace Fuse Holder P/N 153-1028
Yes
Wire to Motor Loose or Damaged
Yes
Re-Attach Loose Wire or Replace Damaged Wire
No
PLC Output 101CH 01 Tests OK
No
Replace PLC P/N 158-1610P
No
Head Motor Tests OK
Yes
Click To Email KMK Experts
No
Replace Motor P/N 158-1605
No
Replace Motor P/N 158-8405